

ADDENDUM NO. 1

**Measure C Pearson Rd Improvements Project
Federal Project No. HSIPL 5425 (027)**

March 7, 2016

OWNER:

Town of Paradise
5555 Skyway
Paradise, CA 95969
(530) 872-6291
(530) 877-5059 (fax)

GENERAL:

Scope:

1. The purpose of this Addendum No. 1 is to notify Bidders of clarifications to the Contract Documents for the above project. This Addendum shall be attached to and become a part of said Contract Documents.
2. This Addendum consists of 15 pages, including attachments.

Acknowledgment:

1. This Addendum shall be signed by the bidder, dated and submitted with the bid package for the project

BID BOOK IS MODIFIED AS FOLLOWS:

1. All references to pre-paving grinding and inertial profiling for smoothness testing shall be removed. Specifically, the following sections are deleted:

39-1.01C(13)(c),
39-1.01C(13)(d),
39-1.01D(6)(c),
39-1.01D(8)(j)(ii),
39-1.01D(8)(j)(iii),

2. Page 120, Section 39-1.01D(8)(j)(i) "PAVEMENT SMOOTHNESS, GENERAL"

Replace this section with the following:

Test Pavement smoothness using a 12-foot straightedge for all locations.

3. Page 123, Section 39-1.01D(9)(c) "PAVEMENT SMOOTHNESS"

Replace this section with the following:

For areas that require pavement smoothness determined using a 12-foot straightedge, the HMA pavement surface must not vary from the lower edge of the straightedge by more than:

- 0.01 foot when the straightedge is laid parallel with the centerline
- 0.02 foot when the straightedge is laid perpendicular to the centerline and extends from edge to edge of a traffic lane
- 0.02 foot when the straightedge is laid within 24 feet of a pavement conform

Pavement smoothness may be accepted based on your testing in the absence of the Department's testing.

4. Page 159, Section 39.C-3 "HOT MIX ASPHALT, CONSTRUCTION"

Delete the first paragraph as shown below:

~~Use a material transfer vehicle when placing RHMA-G.~~

5. Appendix B – Monument Corner Records

Replace Appendix B with Attachment 1 of this addendum.

CLARIFICATION TO THE RFP IS PROVIDED AS FOLLOWS:

Question 1: Where are the quantities for Bid Item 24, Minor Hot Mix Asphalt – Mainline being placed?

Answer 1: *Reference Sheets 8, 9, 11, 12, 14, 15 and 16 for Corrective HMA lift and Super Elevation Correction*

Question 2: How is hot mix asphalt paid for in Bid Items 29 and 30 "Place Asphalt Dike (Type A and E)"?

Answer 2: *Reference Page 136, Section 39.A-4 PAYMENT. Payment for the HMA used to construct the dike **is included** in the payment for "Place Asphalt Dike" and further compensation will be made.*

Question 3: Can you clarify or confirm required compaction testing methods for varying lift thicknesses of Hot Mix Asphalt?

Answer 3: *Section 39-1.030(2) Method Compaction applies to lifts less than 0.15 foot shown on the plans. Reference Section 39.C Construction for RHMA-G placed under method compaction. Lifts of 0.15 foot shall be compaction tested as specified in Section 39-3.01D(3)(d). All language relating to testing remains unchanged by this addendum.*

Question 4: Can you provide a list of attendees from the Mandatory Pre-Bid Meeting?

Answer 4: *Pre-Bid Attendee list is included as Attachment 2 to this addendum.*

PROPOSER:

PREPARED BY:

NAME



03/14/16

ADDRESS 1

TOWN OF PARADISE

DATE

ADDRESS 2

SIGNATURE DATE

END OF ADDENDUM


CORNER RECORD

Document Number: 23-7

City of: PARADISE

County of: BUTTE, California

Brief Legal Description: A PORTION OF THE NORTHWEST QUARTER OF THE NORTHEAST QUARTER OF SECTION 23, TOWNSHIP 22 NORTH, RANGE 3 EAST, MOUNT DIABLO MERIDIAN, AS SHOWN ON BOOK 160 OF MAPS, AT PAGE 37, BUTTE COUNTY OFFICIAL RECORDS.

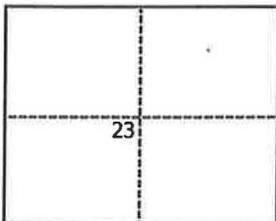

CORNER TYPE

- Government Corner Control
- Meander Property
- Rancho Other

COORDINATES (Optional)

- N. _____
- E. _____
- Zone: _____ NAD27 NAD83
- NAD83 Epoch: _____
- Elevation: _____
- Vert. Datum: NVGD29 NAVD88
- Meas. Units: Metric Imperial

Date of Survey: January 8, 2016

Corner: Left as Found Found and Tagged Established Reestablished Rebuilt

Identification and type of corner found: Evidence used to identify or procedure used to establish or reestablish the corner:
USED STANDARD SURVEYING PRACTICES TO LOCATE ROAD CENTERLINE MONUMENT AS SHOWN ON MAP BOOK 160, PAGE 37.
ESTABLISHED FOUR REFERENCE TIES TO SAID MONUMENT THAT IS AT RISK FOR DESTRUCTION BY PROPOSED ROAD IMPROVEMENTS.

A description of the physical condition of the monument as found and as set or reset:
FOUND A RAIL ROAD SPIKE WITH NO MARKINGS AT PAVEMENT SURFACE.

SURVEYOR'S STATEMENT

This Corner Record was prepared by me or under my direction in conformance with the Land Surveyor's Act on: January 25, 2016

Signed: *[Signature]* P.L.S. or R.C.E. Number: PLS 6967
MICHAEL L. MAYS




COUNTY SURVEYOR'S STATEMENT

This Corner Record was received on January 29, 2016 and examined and filed on February 3, 2016.


Signed: *[Signature]* P.L.S. or R.C.E. Number: 8096
Title: Deputy County Surveyor



County Surveyor's Comments:

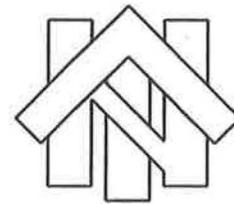

SCALE: 1" = 20'

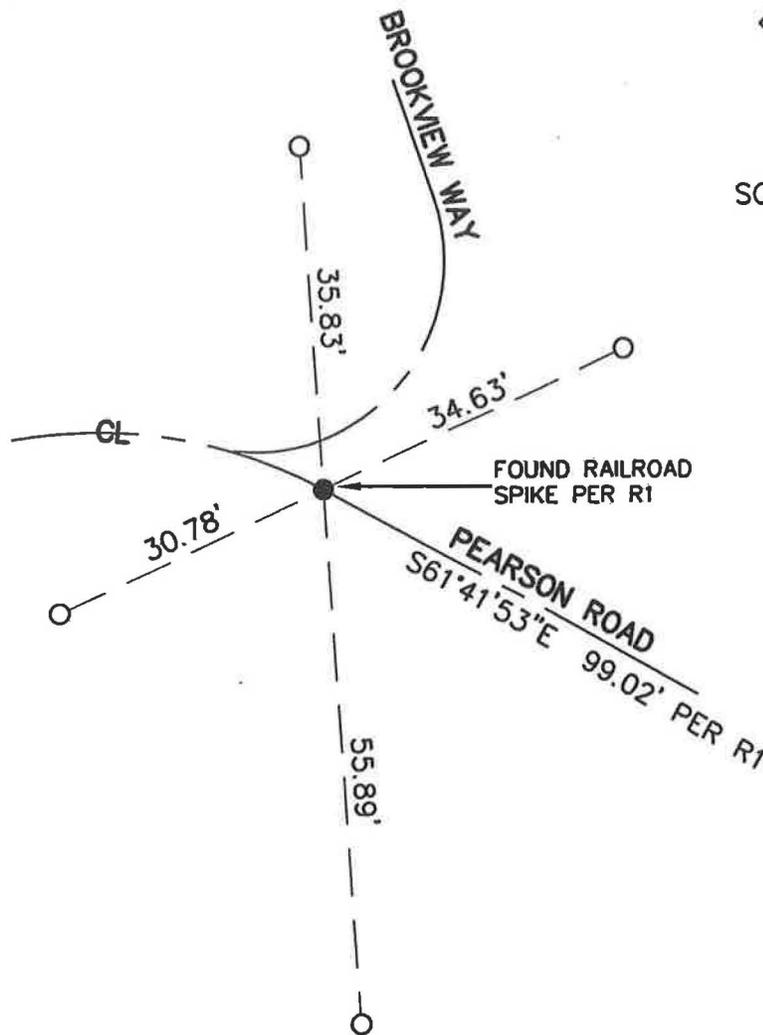

LEGEND

- FOUND MONUMENT AS NOTED PER R1
- SET 1/2" REBAR AND CAP STAMPED "NORTHSTAR CONTROL" FOR REFERENCE POINT
- R1 RECORD DATA PER BOOK 160 OF MAPS, AT PAGE 37
- CL CENTERLINE

JOB NO. 15-101

NorthStar
ENGINEERING

111 MISSION RANCH BLVD., STE. 100
CHICO, CALIFORNIA 95926
(530) 893-1600 FAX (530) 893-2113

CORNER RECORD

Document Number: 23-8

City of: PARADISE

County of: BUTTE, California

Brief Legal Description: A PORTION OF THE NORTHWEST QUARTER OF THE NORTHEAST QUARTER OF SECTION 23, TOWNSHIP 22 NORTH, RANGE 3 EAST, MOUNT DIABLO MERIDIAN, AS SHOWN ON BOOK 160 OF MAPS, AT PAGE 37, BUTTE COUNTY OFFICIAL RECORDS.



CORNER TYPE

- Government Corner Control
- Meander Property
- Rancho Other

Date of Survey: January 8, 2016

COORDINATES (Optional)

- N. _____
E. _____
Zone: _____ NAD27 NAD83
- NAD83 Epoch: _____
Elevation: _____
- Vert. Datum: NVGD29 NAVD88
- Meas. Units: Metric Imperial

Corner: Left as Found Found and Tagged Established Reestablished Rebuilt

Identification and type of corner found: Evidence used to identify or procedure used to establish or reestablish the corner:
USED STANDARD SURVEYING PRACTICES TO LOCATE ROAD CENTERLINE MONUMENT AS SHOWN ON MAP BOOK 160, PAGE 37.
ESTABLISHED FOUR REFERENCE TIES TO SAID MONUMENT THAT IS AT RISK FOR DESTRUCTION BY PROPOSED ROAD IMPROVEMENTS.

A description of the physical condition of the monument as found and as set or reset:
FOUND A RAIL ROAD SPIKE WITH NO MARKINGS AT PAVEMENT SURFACE.

SURVEYOR'S STATEMENT

This Corner Record was prepared by me or under my direction in conformance with the Land Surveyor's Act on: January 25, 2016.


Signed: [Signature] P.L.S. or R.C.E. Number: PLS 6967
MICHAEL L. MAYS




COUNTY SURVEYOR'S STATEMENT

This Corner Record was received on January 29, 2016 and examined and filed on February 3, 2016.


Signed: [Signature] P.L.S. or R.C.E. Number: 8096
Title: Butte County Surveyor

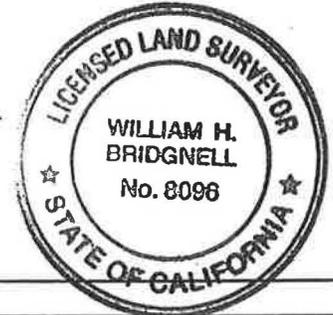

County Surveyor's Comments:

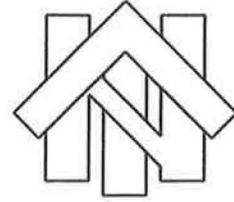

SCALE: 1" = 20'

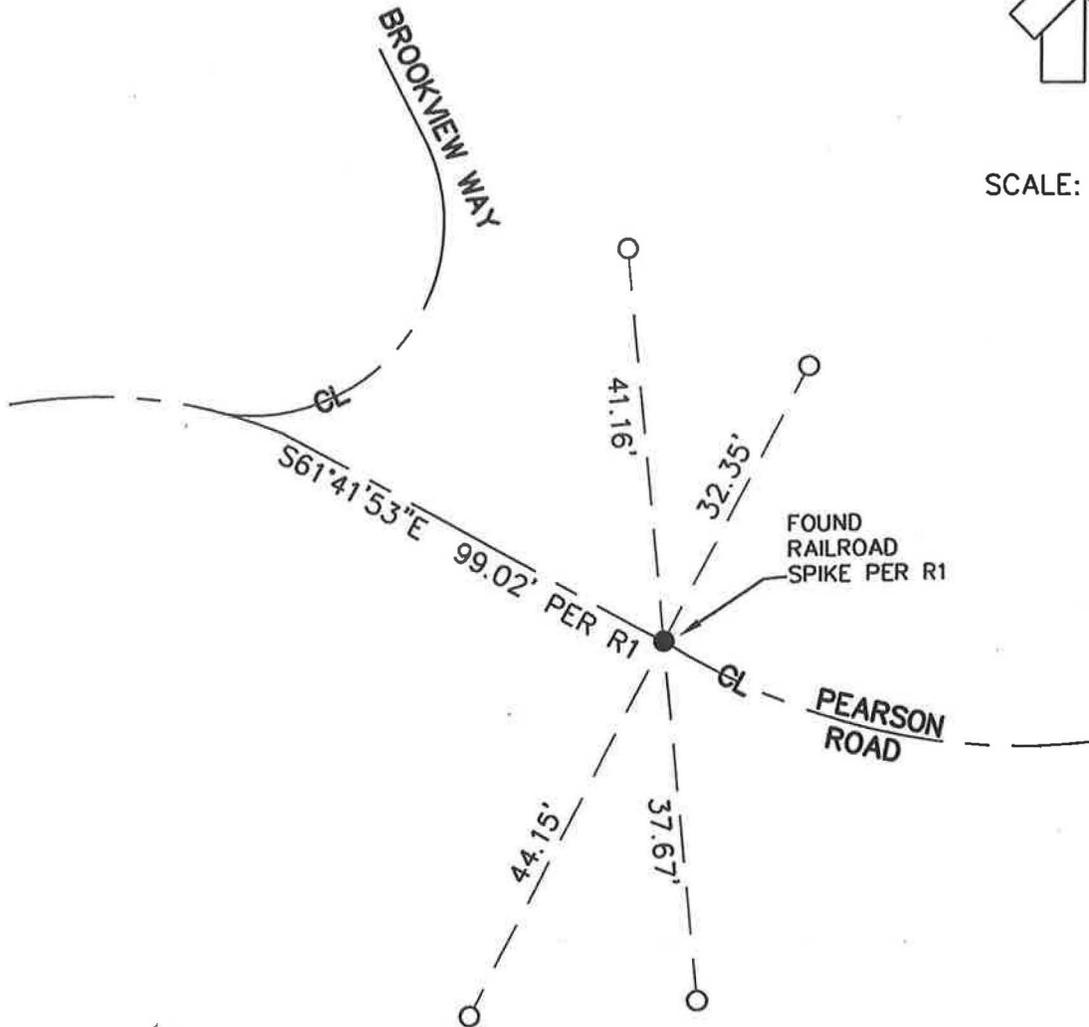

LEGEND

- FOUND MONUMENT AS NOTED PER R1
- SET 1/2" REBAR AND CAP STAMPED "NORTHSTAR CONTROL" FOR REFERENCE POINT
- R1 RECORD DATA PER BOOK 160 OF MAPS, AT PAGE 37
- CL CENTERLINE

JOB NO. 15-101

NorthStar
ENGINEERING

111 MISSION RANCH BLVD., STE. 100
CHICO, CALIFORNIA 95926
(530) 893-1600 FAX (530) 893-2113


CORNER RECORD

Document Number: 24-2

City of: PARADISE

County of: BUTTE, California

Brief Legal Description: A PORTION OF THE NORTHEAST QUARTER OF THE SOUTHWEST QUARTER OF SECTION 24, TOWNSHIP 22 NORTH, RANGE 3 EAST, MOUNT DIABLO MERIDIAN, AS SHOWN ON BOOK 172 OF MAPS, AT PAGE 75 BUTTE COUNTY OFFICIAL RECORDS.

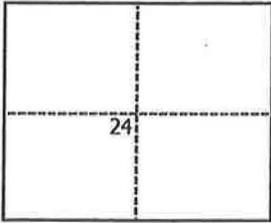

CORNER TYPE

Government Corner Control
 Meander Property
 Rancho Other

COORDINATES (Optional)

N. _____
 E. _____
 Zone: _____ NAD27 NAD83
 NAD83 Epoch: _____
 Elevation: _____
 Vert. Datum: NVGD29 NAVD88
 Meas. Units: Metric Imperial

Date of Survey: January 8, 2016

Corner: Left as Found Found and Tagged Established Reestablished Rebuilt

Identification and type of corner found: Evidence used to identify or procedure used to establish or reestablish the corner:
USED STANDARD SURVEYING PRACTICES TO LOCATE MONUMENT ON THE CENTERLINE OF PEARSON ROAD AT IT'S INTERSECTION WITH SAWMILL ROAD SAID MONUMENT ALSO BEING THE CENTER CORNER OF SAID SECTION 24, AS SHOWN ON MAP BOOK 172 AT PAGE 75.
ESTABLISHED FOUR REFERENCE TIES TO SAID MONUMENT THAT IS AT RISK FOR DESTRUCTION BY PROPOSED ROAD IMPROVEMENTS.

A description of the physical condition of the monument as found and as set or reset:
FOUND A 2 3/4" BRASS DISC, STAMPED LS 3634, IN CONCRETE AND IN A MONUMENT WELL.

SURVEYOR'S STATEMENT

This Corner Record was prepared by me or under my direction in conformance with the Land Surveyor's Act on: January 25, 2016

Signed: [Signature] P.L.S. or R.C.E. Number: PLS 6967
 MICHAEL L. MAYS




COUNTY SURVEYOR'S STATEMENT

This Corner Record was received on January 29, 2016 and examined and filed on February 3, 2016.


Signed: [Signature] P.L.S. or R.C.E. Number: 5096
 Title: Deputy County Surveyor



County Surveyor's Comments:

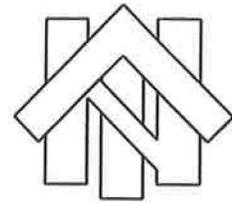

SCALE: 1" = 20'

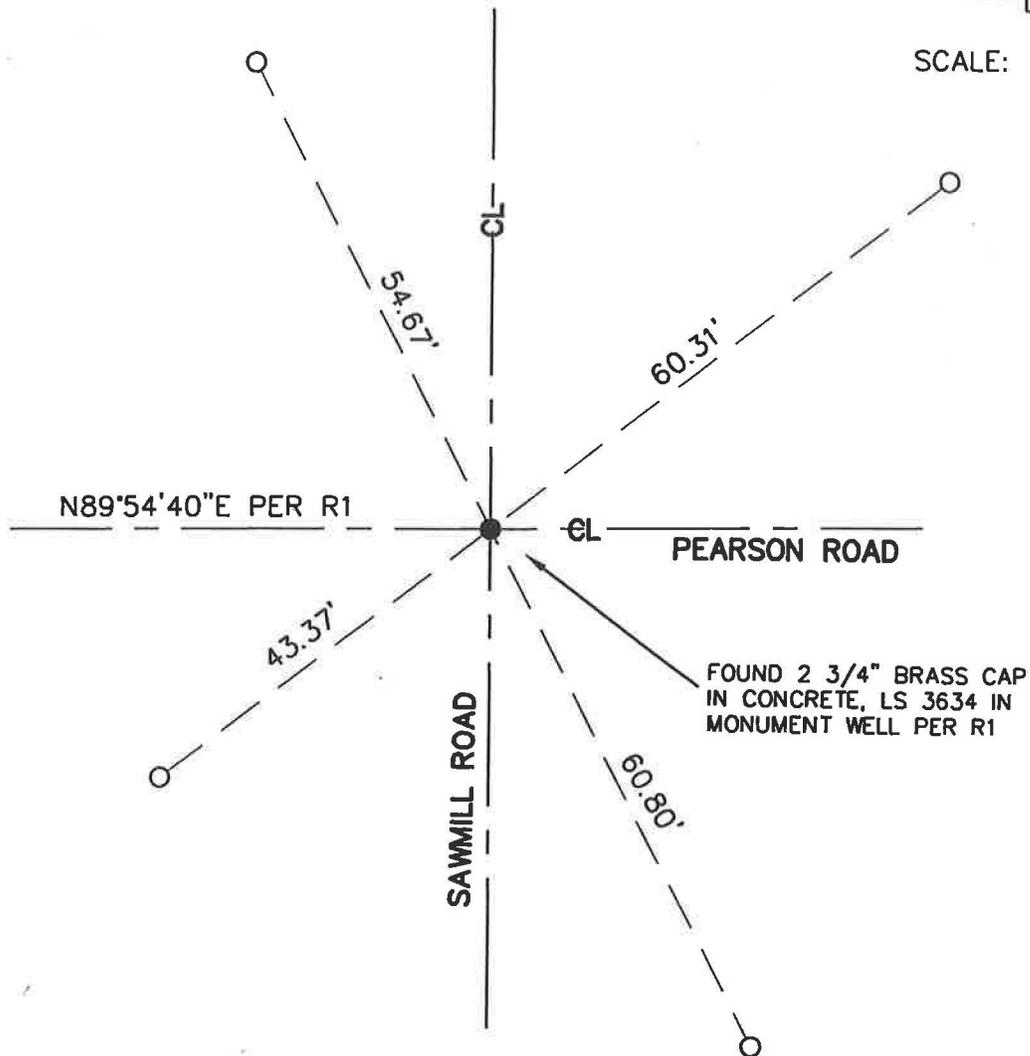

LEGEND

- FOUND MONUMENT AS NOTED PER R1
- SET 1/2" REBAR AND CAP STAMPED "NORTHSTAR CONTROL" FOR REFERENCE POINT
- R1 RECORD DATA PER BOOK 172 OF MAPS, AT PAGES 74-77
- CL CENTERLINE

JOB NO. 15-101

NorthStar
ENGINEERING

111 MISSION RANCH BLVD., STE. 100
CHICO, CALIFORNIA 95926
(530) 893-1600 FAX (530) 893-2113


CORNER RECORD

Document Number: 24-3

City of: PARADISE

County of: BUTTE, California

Brief Legal Description: A PORTION OF THE SOUTHEAST QUARTER OF THE NORTHEAST QUARTER OF SECTION 24, TOWNSHIP 22 NORTH, RANGE 3 EAST, MOUNT DIABLO MERIDIAN, AS SHOWN ON BOOK 132 OF MAPS, AT PAGE 51, BUTTE COUNTY OFFICIAL RECORDS.

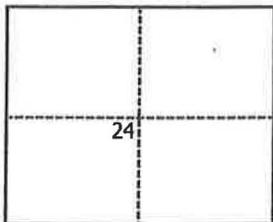

CORNER TYPE

- Government Corner Control
- Meander Property
- Rancho Other

Date of Survey: January 8, 2016

COORDINATES (Optional)

- N. _____
- E. _____
- Zone: _____ NAD27 NAD83
- NAD83 Epoch: _____
- Elevation: _____
- Vert. Datum: NVGD29 NAVD88
- Meas. Units: Metric Imperial

Corner: Left as Found Found and Tagged Established Reestablished Rebuilt

Identification and type of corner found: Evidence used to identify or procedure used to establish or reestablish the corner:
USED STANDARD SURVEYING PRACTICES TO LOCATE A MONUMENT ON THE CENTERLINE OF PEARSON ROAD AT IT'S INTERSECTION WITH EDGEWOOD LANE. SAID MONUMENT BEING A 1/16 CORNER OF SAID SECTION 24 AS SHOWN ON MAP BOOK 132 AT PAGE 51.
ESTABLISHED FOUR REFERENCE TIES TO SAID MONUMENT THAT IS AT RISK FOR DESTRUCTION BY PROPOSED ROAD IMPROVEMENTS.

A description of the physical condition of the monument as found and as set or reset:
FOUND A 2 1/2" BRASS DISC WITH PUNCH, STAMPED "BUTTE COUNTY" ... (REST OF MARKINGS ARE ILLEGIBLE).
IN ASPHALT PAVING AT ROADWAY SURFACE.

SURVEYOR'S STATEMENT

This Corner Record was prepared by me or under my direction in conformance with the Land Surveyor's Act on: January 25, 2016

Signed: [Signature] P.L.S. or R.C.E. Number: PLS 6967
MICHAEL L. MAYS




COUNTY SURVEYOR'S STATEMENT

This Corner Record was received on January 29, 2016 and examined and filed on February 3, 2016.


Signed: [Signature] P.L.S. or R.C.E. Number: 8096
Title: Deputy County Surveyor



County Surveyor's Comments:

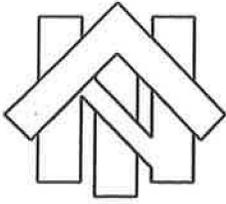

SCALE: 1" = 20'

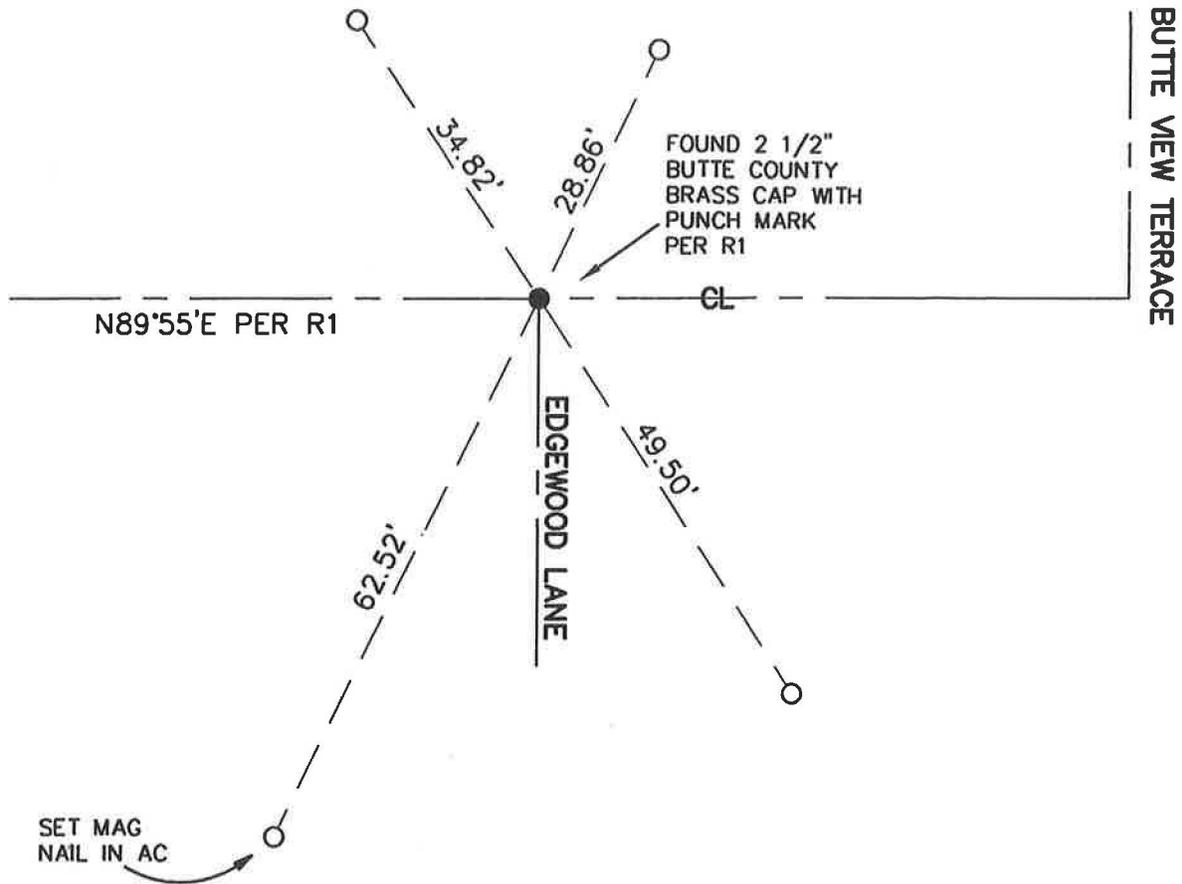

LEGEND

- FOUND MONUMENT AS NOTED PER R1
- SET 1/2" REBAR AND CAP STAMPED "NORTHSTAR CONTROL" FOR REFERENCE POINT OR AS NOTED
- R1 RECORD DATA PER BOOK 132 OF MAPS, AT PAGE 51
- CL CENTERLINE

JOB NO. 15-101

NorthStar
ENGINEERING

111 MISSION RANCH BLVD., STE. 100
CHICO, CALIFORNIA 95926
(530) 893-1600 FAX (530) 893-2113

CORNER RECORD

Document Number: 24-4

City of: PARADISE

County of: BUTTE, California

Brief Legal Description: A PORTION OF THE NORTHEAST QUARTER OF THE SOUTHEAST QUARTER OF SECTION 24, TOWNSHIP 22 NORTH, RANGE 3 EAST, MOUNT DIABLO MERIDIAN, AS SHOWN ON BOOK 132 OF MAPS, AT PAGE 51, BUTTE COUNTY OFFICIAL RECORDS.



CORNER TYPE

- Government Corner Control
- Meander Property
- Rancho Other

COORDINATES (Optional)

- N. _____
- E. _____
- Zone: _____ NAD27 NAD83
- NAD83 Epoch: _____
- Elevation: _____
- Vert. Datum: NVGD29 NAVD88
- Meas. Units: Metric Imperial

Date of Survey: January 8, 2016

Corner: Left as Found Found and Tagged Established Reestablished Rebuilt

Identification and type of corner found: Evidence used to identify or procedure used to establish or reestablish the corner:
USED STANDARD SURVEYING PRACTICES TO LOCATE MONUMENT ON THE CENTERLINE OF PEARSON ROAD AT IT'S INTERSECTION WITH HILLTOP DRIVE AND STEARNS ROAD. SAID MONUMENT ALSO BEING THE EAST ONE-QUARTER CORNER OF SAID SECTION 24, AS SHOWN ON MAP BOOK 132 AT PAGE 51. ESTABLISHED FOUR REFERENCE TIES TO SAID MONUMENT THAT IS AT RISK FOR DESTRUCTION BY PROPOSED ROAD IMPROVEMENTS.

A description of the physical condition of the monument as found and as set or reset:
FOUND A 2" BRASS DISC STAMPED "BUTTE COUNTY PUBLIC WORKS DEPT, T22N, 19 1/4 COR, REPLACED 1978", IN ASPHALT PAVING APPROXIMATELY 1/2" BELOW ROAD SURFACE.

SURVEYOR'S STATEMENT

This Corner Record was prepared by me or under my direction in conformance with the Land Surveyor's Act on: February 9, 2016

Signed: [Signature] P.L.S. or R.C.E. Number: PLS 6967
MICHAEL L. MAYS




COUNTY SURVEYOR'S STATEMENT

This Corner Record was received on January 29, 2016 and examined and filed on FEBRUARY 24, 2016.


Signed: [Signature] P.L.S. or R.C.E. Number: 8096
Title: Deputy County Surveyor



County Surveyor's Comments:

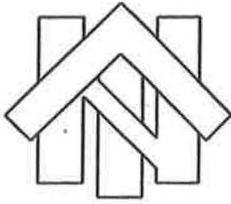

SCALE: 1" = 20'

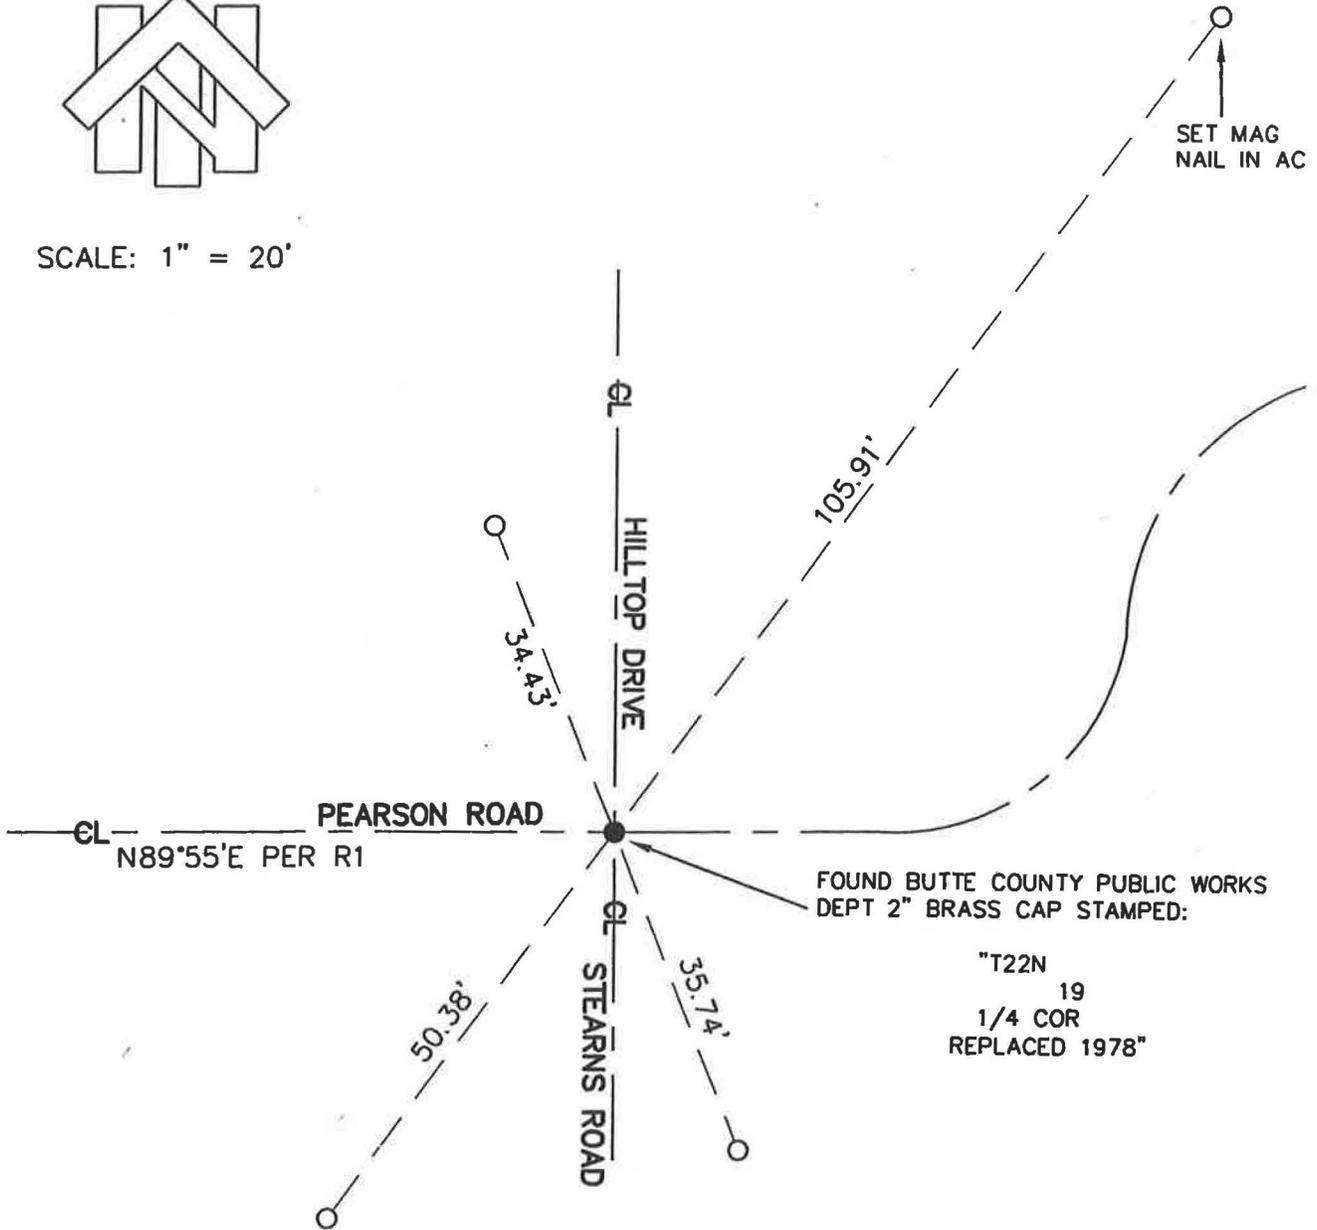

LEGEND

- FOUND MONUMENT AS NOTED PER R1
- SET 1/2" REBAR AND CAP STAMPED "NORTHSTAR CONTROL" FOR REFERENCE POINT OR AS NOTED
- R1 RECORD DATA PER BOOK 132 OF MAPS, AT PAGE 51
- CL CENTERLINE

JOB NO. 15-101

NorthStar
ENGINEERING

111 MISSION RANCH BLVD., STE. 100
CHICO, CALIFORNIA 95926
(530) 893-1600 FAX (530) 893-2113

CORNER RECORD

Document Number: 24-5

City of: PARADISE

County of: BUTTE, California

Brief Legal Description: A PORTION OF THE NORTHWEST QUARTER SECTION 24, TOWNSHIP 22 NORTH, RANGE 3 EAST, MOUNT DIABLO MERIDIAN, AS SHOWN ON BOOK 45 OF MAPS, AT PAGE 70, BUTTE COUNTY OFFICIAL RECORDS.



CORNER TYPE

- Government Corner Control
- Meander Property
- Rancho Other

Date of Survey: January 8, 2016

COORDINATES (Optional)

- N. _____
- E. _____
- Zone: NAD27 NAD83
- NAD83 Epoch: _____
- Elevation: _____
- Vert. Datum: NVGD29 NAVD88
- Meas. Units: Metric Imperial

Corner: Left as Found Found and Tagged Established Reestablished Rebuilt

Identification and type of corner found: Evidence used to identify or procedure used to establish or reestablish the corner:
USED STANDARD SURVEYING PRACTICES TO LOCATE A ROAD CENTERLINE MONUMENT LOCATED AT THE NORTHWEST CORNER OF THE
SOUTHWEST ONE-QUARTER OF THE NORTHWEST ONE-QUARTER OF SAID SECTION 24, SHOWN ON MAP BOOK 45 AT PAGE 70.
ESTABLISHED FOUR REFERENCE TIES TO SAID MONUMENT THAT IS AT RISK FOR DESTRUCTION BY PROPOSED ROAD IMPROVEMENTS.

A description of the physical condition of the monument as found and as set or reset:
FOUND A RAILROAD SPIKE WITH NO MARKINGS AT PAVEMENT SURFACE.

SURVEYOR'S STATEMENT

This Corner Record was prepared by me or under my direction in conformance with the Land Surveyor's Act on: February 9, 2016

Signed: *[Signature]* P.L.S. or R.C.E. Number: PLS 6967
MICHAEL L. MAYS




COUNTY SURVEYOR'S STATEMENT

This Corner Record was received on January 29, 2016 and examined and filed on FEBRUARY 24, 2016.


Signed: *[Signature]* P.L.S. or R.C.E. Number: 8096
Title: Deputy County Surveyor



County Surveyor's Comments:

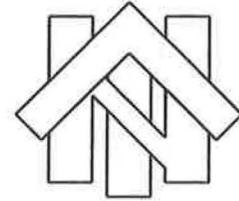

SCALE: 1" = 20'

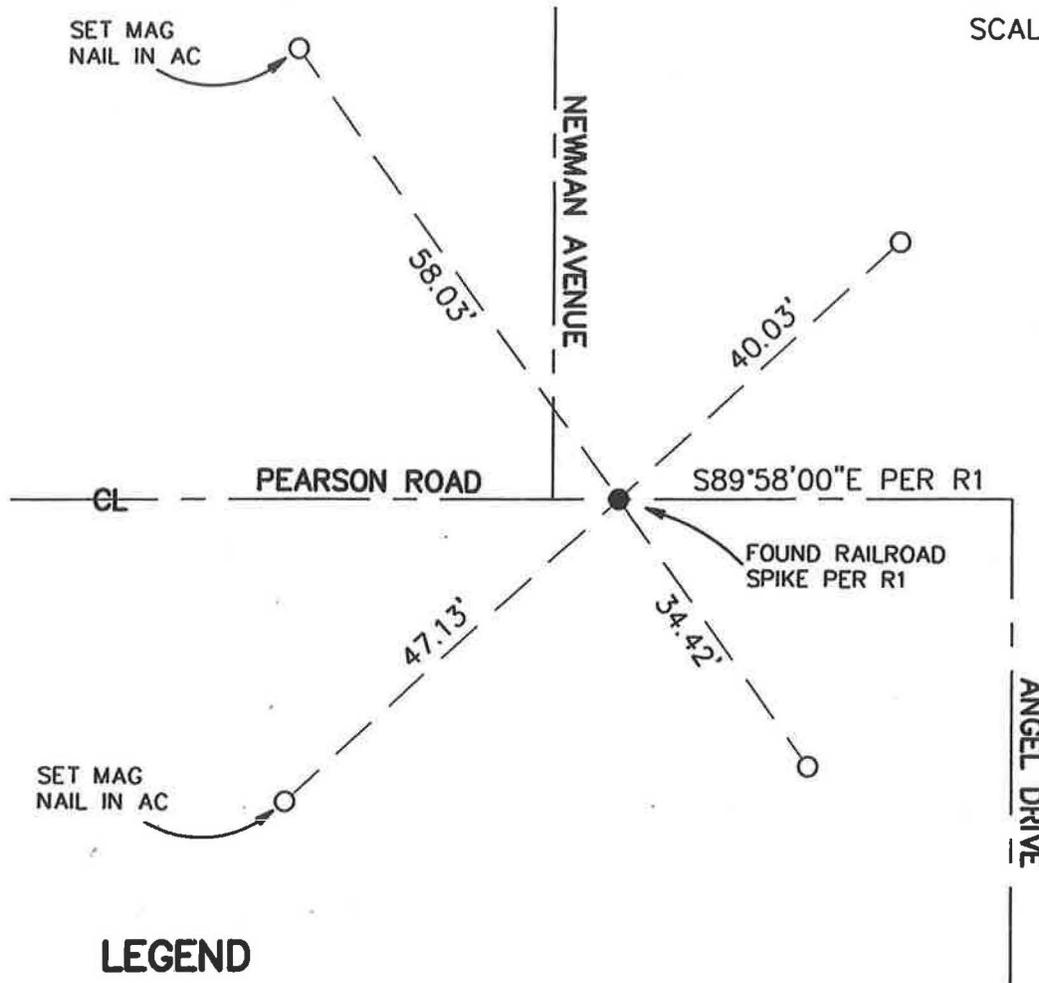

LEGEND

- FOUND MONUMENT AS NOTED PER R1
- SET 1/2" REBAR AND CAP STAMPED "NORTHSTAR CONTROL" FOR REFERENCE POINT OR AS NOTED
- R1 RECORD DATA PER BOOK 45 OF MAPS, AT PAGE 70
- CL CENTERLINE

JOB NO. 15-101

NorthStar
ENGINEERING

111 MISSION RANCH BLVD., STE. 100
CHICO, CALIFORNIA 95926
(530) 893-1600 FAX (530) 893-2113



TOWN OF PARADISE
Engineering
5555 Skyway
Paradise, CA 95969
(530) 872-6291

Measure "C" Pearson Rd Improvements Project
Federal Project No. HSIPL 5425 (027)
Mandatory Pre-Bid Meeting

10:00 AM on March 10, 2016
5555 Skyway, Paradise, CA 95969

Sign-In Sheet

Name	Company	Certified DBE?	Email Address
Jared Springer	Knife River	NO	jared.springer@knifetriver.com
Tyler Rhoades	S.T. Rhoades	Yes	tyler@stohoadesinc.com
Dean Canard	Lamon	NO	dean@rhbca.com
RADLEY OTT	NORTHSTAR ENG.	No	rott@northstareng.com
TOM HALL	M.T. HALL & Assoc	NO	TOM@MTHALLASSOCIATES.COM
ROGER MAIER	FRANKLIN CONST	No	roger@franklinconstruction.com
Barry Short	Pavement Coatings	No	barry@pavementcoatings.com
Mark Mattox	TOP	N/A	mmattox@townofparadise.com
MATT GILBERT	TGP	NA	mgilbert@townofparadise.com